
Include product

tWF-PD4R3, tWF-PD4SR2A, tWF-PD4SR2D, tWF-PD8, tWF-R6, tWF-DA1PD2R1 ALM-06-WF

Description of changes

Add timeout for Modbus TCP, connection idle in STA(Station) mode. When both device & Host/Controller connected to an AP(Access Point) in STA mode, if Host/Controller break & loss the connection with AP, it will cause the device hang in a dead connection(device still good with AP, even Host/Controller get back with new connection, but it's not the same socket number as the original). To prevent it happen, set a timeout for device to restart the connection and wait for next connect.

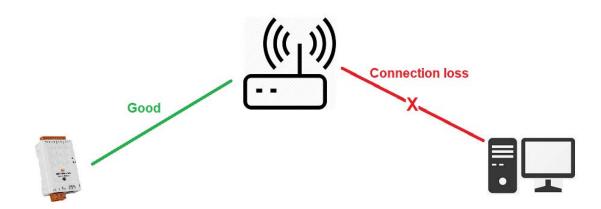


The Idle Timeout for Modbus TCP connection (default is **120 Sec**), user can change it from PC utility, Android APP, HTML or Modbus TCP Command. For more detail please reference to each User's Manual.

꺯 tWF.Setup						_		×
AP				Station				
SSID Name:	tWF-R6-A48021			SSID Name:	tWFHUB			
Key Type:	Open	O WPA/WPA2		Key Type:	⊖ Open		WPA	/WPA2
SSID Key:				SSID Key:				
WEB				Static IP				
Login Key:			~	IP:				
Modbus								-
Port:	502			Net mask:	255.255.2	255.0		
Idle Timeout:	120	Sec		Gate way:				
Location								
String:	Not Set!!			WiFi Mode	AP	○ Station		
					0	0		
Ress	at to Default		上 Update FA	N		CREboot device		
0%								



How to Update

 1. Before update, need to restore device back to default setting AP mode. For more detail please reference to each User's Manual.




|--|

- 2. Unzip file "tWF_update_Patch.zip"
- 3. Using Wi-Fi connect to your target device, Run "tWF_update_Patch.EXE".
- 4. Check F/W Version, it must smaller than V1.10.
- 5. Check Module name whether you are going to update.
- 6. Press "Patch File" to update the F/W.

Si ALM/tWF Update file Patch V1.10(20200325)	_		×	
Get Device Linked!!	R	Link D	evice	
Tiny tWF-R6 Module	Г	Patch File		
Remote IP : 192.168.77.1 Remote MAC: 00:0D:E0:A4:80:21 Ver: 01.00 RSSI	:-55dB	m		
Location : Not Set!! 09	%			

7. After update, ready for reboot.

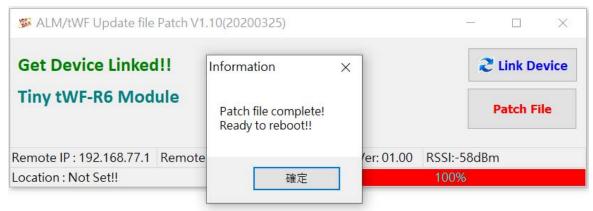



8. After reboot, check the Module name & F/W Version whether correct.

🖇 ALM/tWF Update file	Patch V1.10(20200325)		-	- (\times	
Get Device Linked!! Tiny tWF-R6 Module					2 Link Device		
					Patch File		
Remote IP : 192.168.77.1	Remote MAC: 00:0D:E0:A4:80:21	Ver: 01.10	RSSI:-45	ōdBm			
Location : Not Set!!			100%				