
How to use New Card Wizard?(for serial communication modules)

Topic: When you add ICPDAS serial communication (I-8112, I-8114, I-8142, I-8144) modules or change the slot position of serial communication modules, please run new card wizard to setup, otherwise Wincon-8000 may not recognize these serial communication modules correctly. After executing this wizard, Wincon will save the configuration of serial communication modules in Wincon's registry. Users don't need to repeat these steps while recycle power of Wincon.

 RUN "New Card Wizard.exe" -> [SLOT Scan] -> [Save New Module] -> Yes -> Reboot

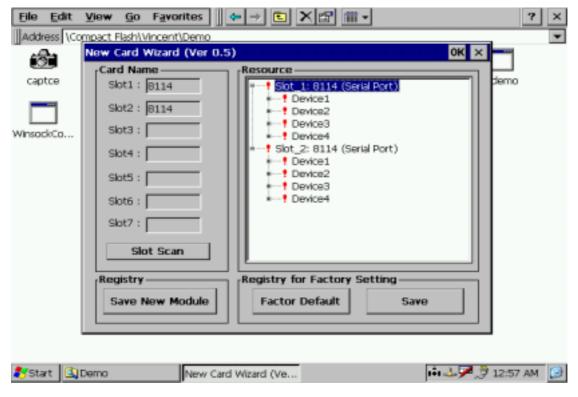

<u>File</u> Edit		← ⇒ € X 🗗 🏛 - ? ×
Address N	1y <u>Computer</u>	· · · · · · · · · · · · · · · · · · ·
	New Card Wizard (Ver 0.5	5) OK 🗙 🦐
2004	Card Name	Resource
Databases	Slot1 : 8114	g Slot_1: 8114 (Serial Port) dows
		! Device1
<u> </u>	Slot2 : 8114	 Device2
CAPTOODO	Slot3 :	Device3 Device4
		Slot_2: 8114 (Serial Port)
	Slot4	
	300	minute to create registry for new Module.
		must be reset to active them.)
	Slott Yes	Cancel
	slot7:	
	Slot Scan	
	Registry	Registry for Factory Setting
	Save New Module	Factor Default Save
🛃 Start [Demo New Car	d Wizard (Ve 🚽 My Computer 🛛 🏟 🕹 🏸 🍠 12:58 AM 😡
2 DEST		Mizerd ever > [Clet Seen] > "Decourse" (Chew

2. RESTART -> RUN "New Card Wizard.exe" -> [Slot Scan] -> "Resource" (Show Com Port Setting)

<u>File</u> Edit	View Go Favorites		? ×
Address C	ompact Flash\Vincent\Demo		*
6	New Card Wizard (Ver 0.	5) OK ×	1
captce	Card Name Slot1 : 8114 Slot2 : 8114 Slot3 : Slot4 : Slot5 : Slot5 : Slot5 : Slot5 : Slot7 :	Resource Slot_1: 8114 (Serial Port) COM5: COM6: COM7: COM8: Slot_2: 8114 (Serial Port) COM9: MSP1: MSP2: MSP3:	10
Start 🔯	Save New Module	Registry for Factory Setting Factor Default Save	08 AM 💽

- Q: How to use 8114 com port?
- A: Same com2 or com3.

NOTE:

 The maximum extend com ports are 10 for WINCON-8000. (8114 * 2 and 8112 * 1) or (8112 * 5)

Limitation

To run this wizard correctly, please make sure :

- Bootloader Version should be RES6 or later version.
- OS image should be upgraded to version released at Sep/02/2004 or later