How to set up a Penmount USB touch panel

Applies to:

Platform	OS version	XPAC utility version
XPAC series	All versions (WinCE6)	All versions

N/A: *Not applicable to this platform and OS.*

Use a touch panel and a keyboard at the same time on XP-8x4x.

The XP-8x4x series only has two USB ports, so if you want use a touch panel and keyboard/mouse at the same time. You will need a USB hub.
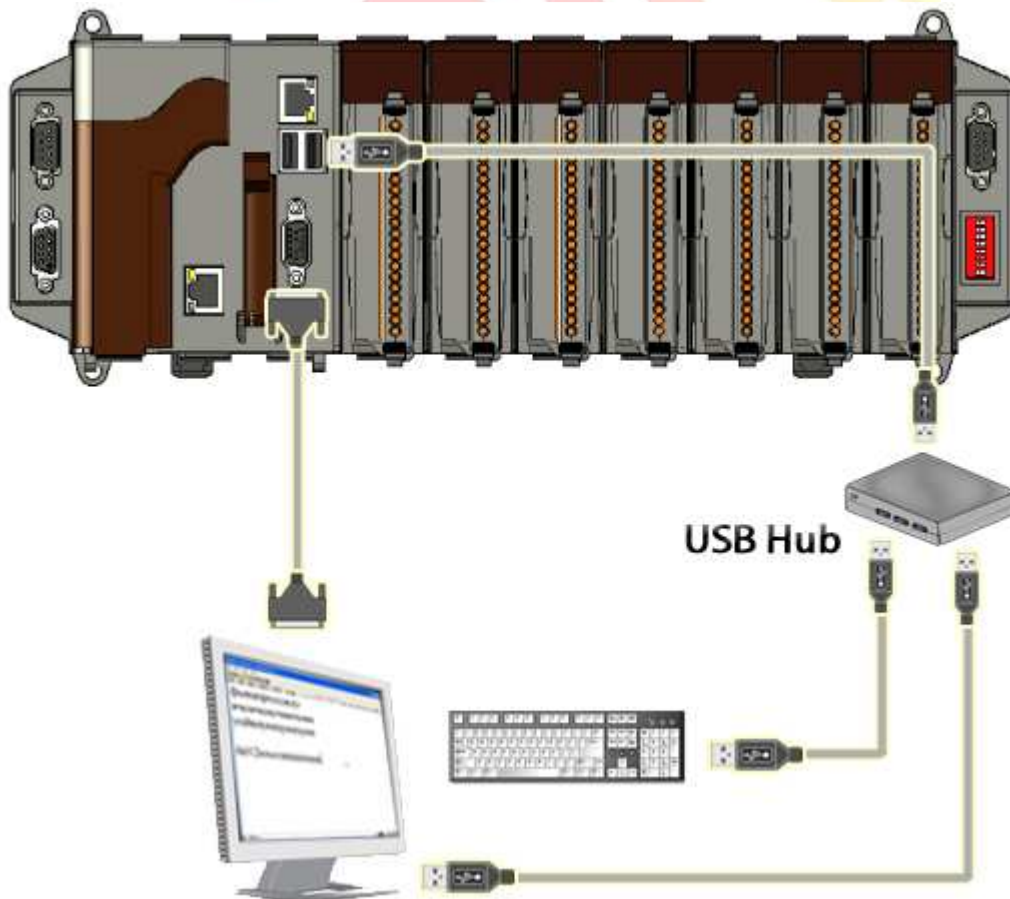
USB Hub

To use a Penmount USB touch panel, perform the following steps:

Step 1: Location of the devices for the touch panel
The PenMount_USB_TOUCH_V3.3_20101103_XPAC_CE6.CAB file is located at (yyyymmdd means Year /Month/ Day)
1. CD:\System_Disk\External_device_driver\PenMount_USB_TOUCH_V3.3_20101103_XPAC_CE6.CAB
2. ftp://ftp.icpdas.com/pub/cd/xp-8000-ce6/napdos/system_disk/external_device_driver/

Step 2: Install the PenMount_USB_TOUCH_V3.3_20101103_XPAC_CE6.CAB file.

2.1. Double click the PenMount_USB_TOUCH_V3.3_20101103_XPAC_CE6.CAB file, and then click "OK".
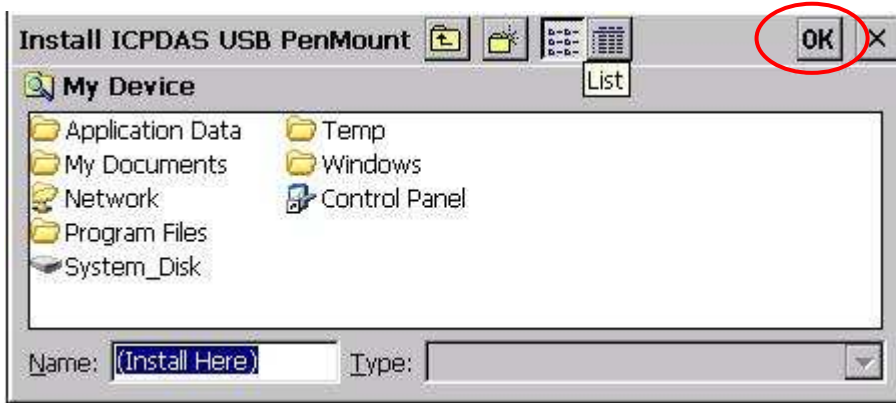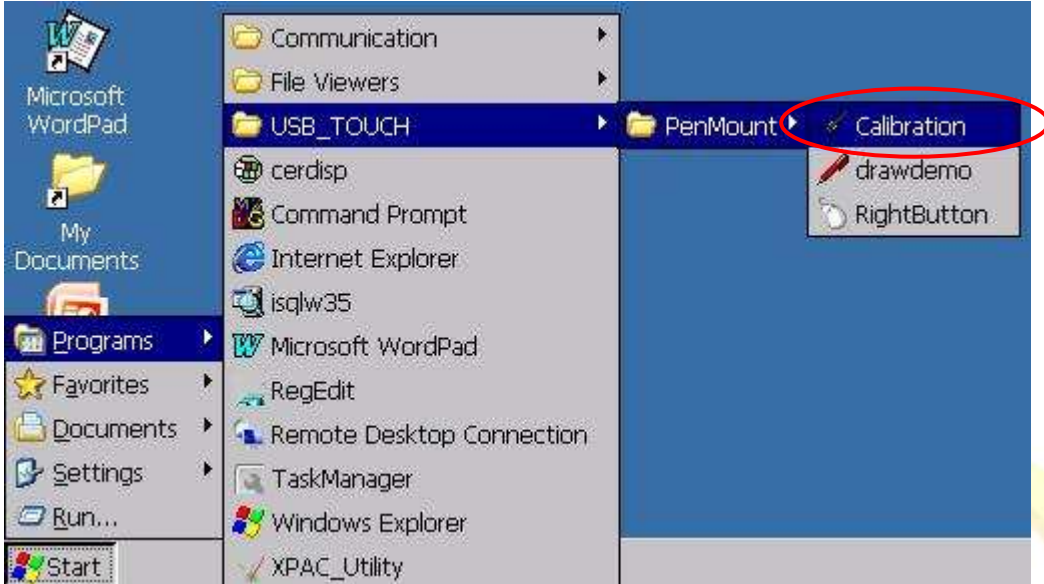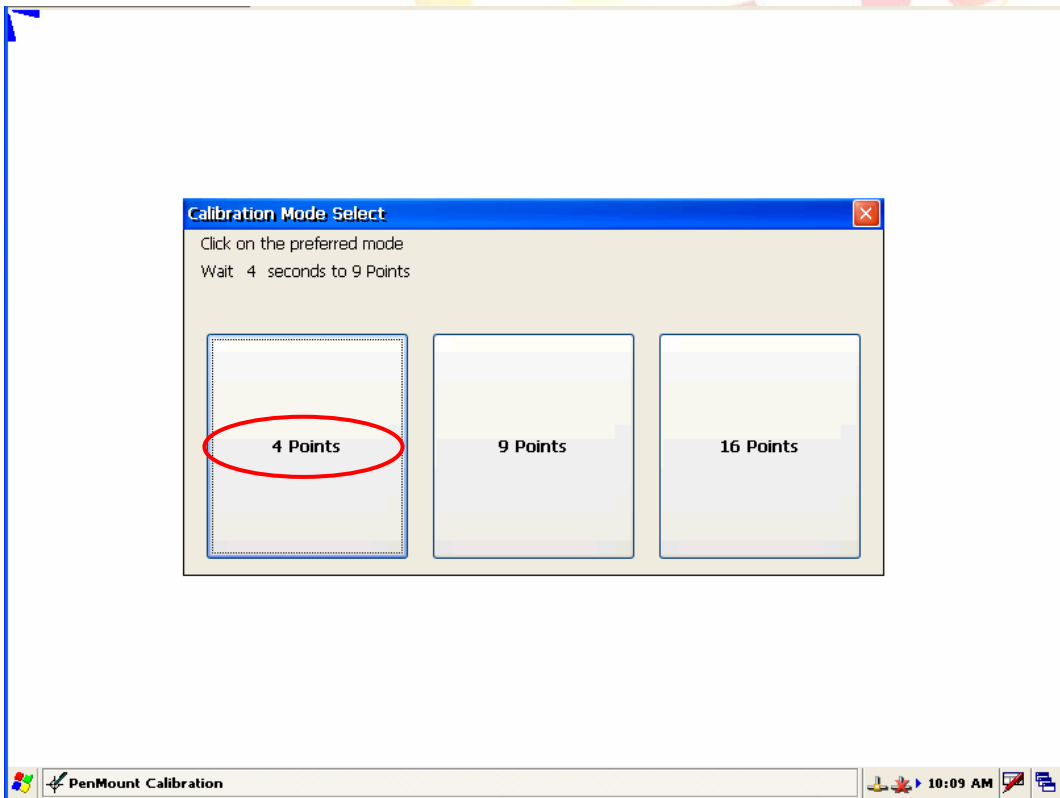

2.2 Double click ok, and will reboot your XAC
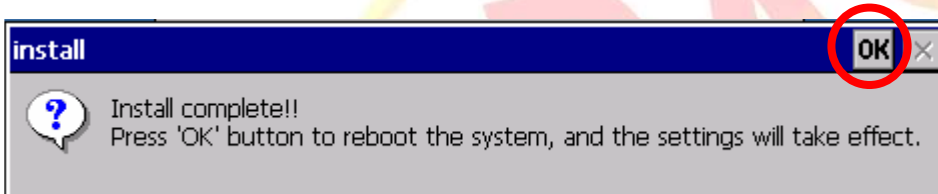
Step 3: Execute the calibration program.

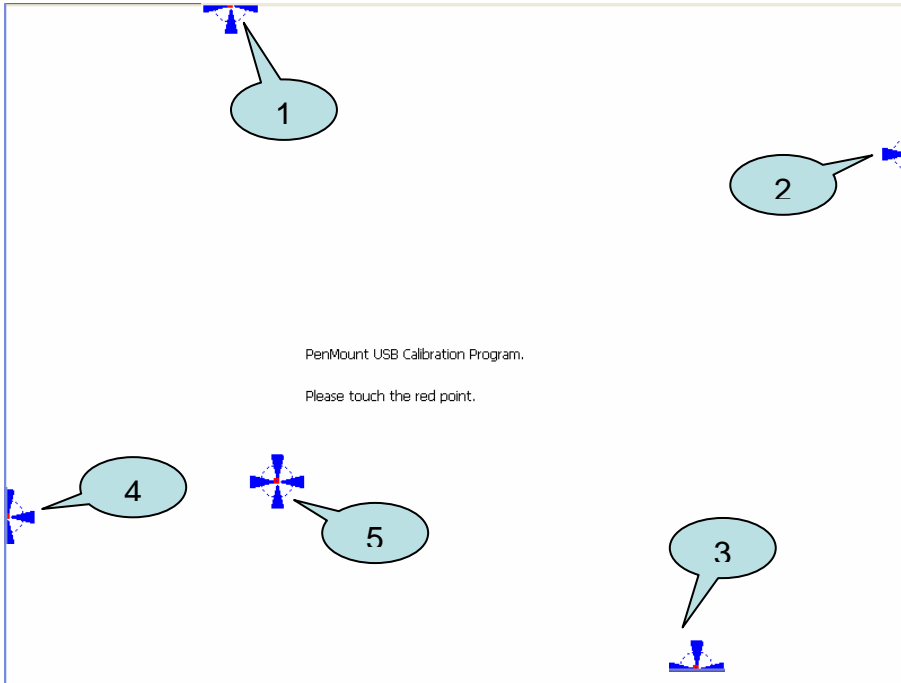3.1. After rebooting, click the Start->USB_TOUCH->PenMount-> Calibration.

3.2. Click the "4 Points" button. (Click the "9 Points" or "16 Points" button to obtain a more accurate calibration for the touch panel)

3.3. Perform the calibration process.

3.3.1. Touch the " " icons on the monitor to perform the calibration process.
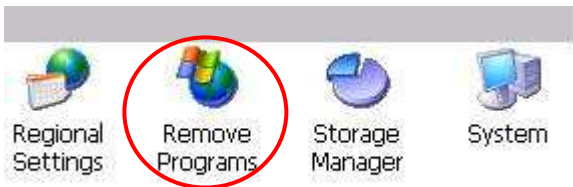
To Uninstall Penmount USB touch driver, perform the following steps:

Step 1: Execute the Remove Program.

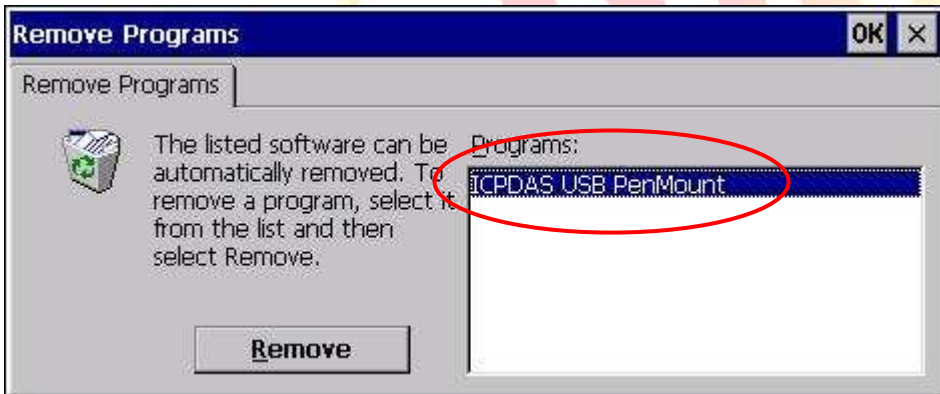1.1 click the Start->Settings ->Control Panel.

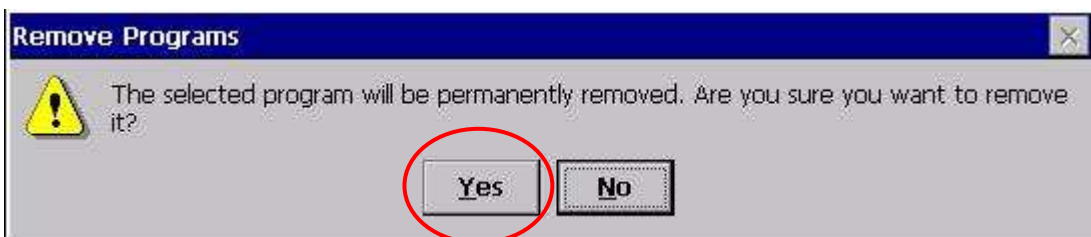1.2 After Open "Control Panel", double click "Remove Programs".

Step 2: Uninstall Penmount USB touch driver.

2.1 After execute "Remove Programs", click "ICPDAS USB PenMount" and then click "Remove" button

2.2 Click "Yes" button, and will uninstall Penmount USB touch driver.

2.3 Click "Yes", and will reboot your XAC to take effect.