How to calibrate a Penmount USB touch panel

Applies to:

Platform	OS version	XPAC utility version
XPAC series	All versions (WinCE6)	All versions

N/A: *Not applicable to this platform and OS.*

Use a touch panel and a keyboard at the same time on XP-8x4x.

The XP-8x4x series only has two USB ports, so if you want use a touch panel and keyboard/mouse at the same time. You will need a USB hub.
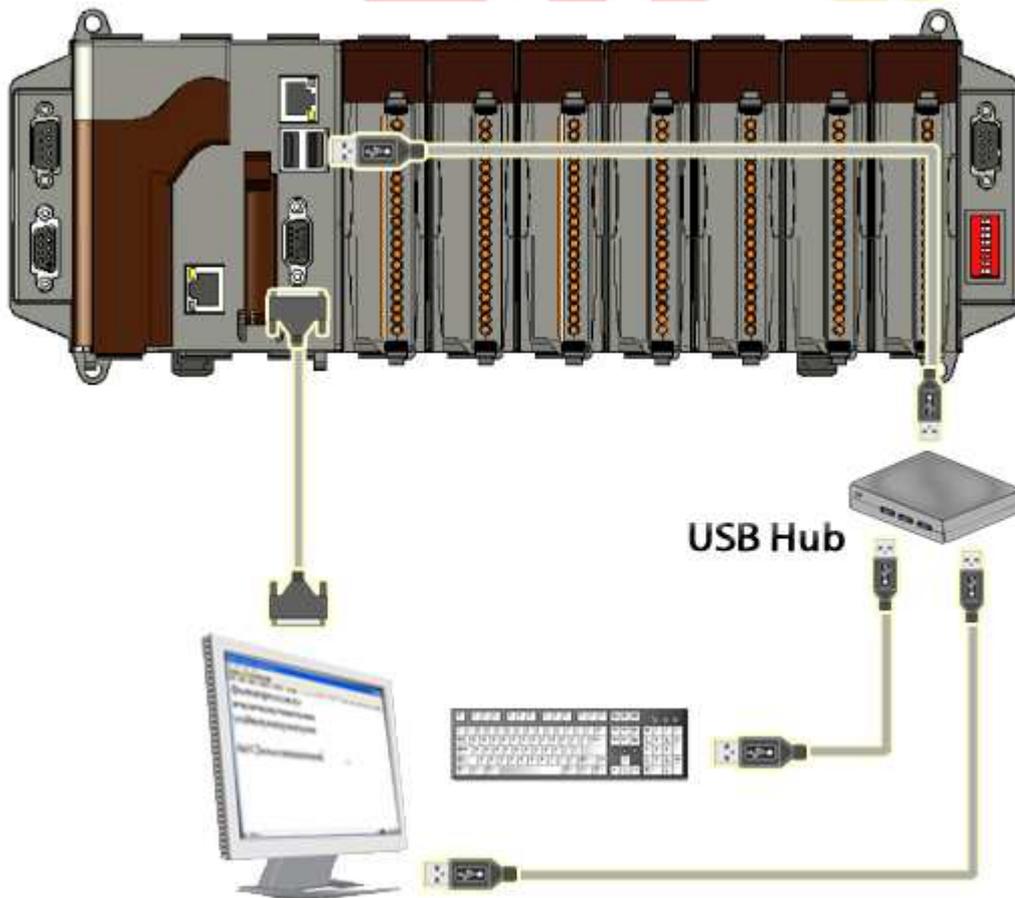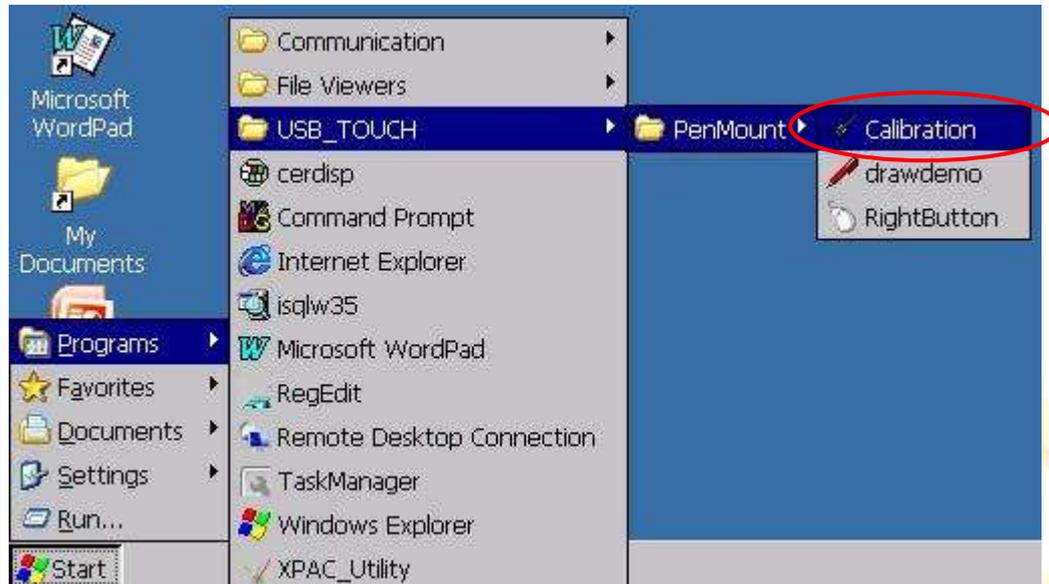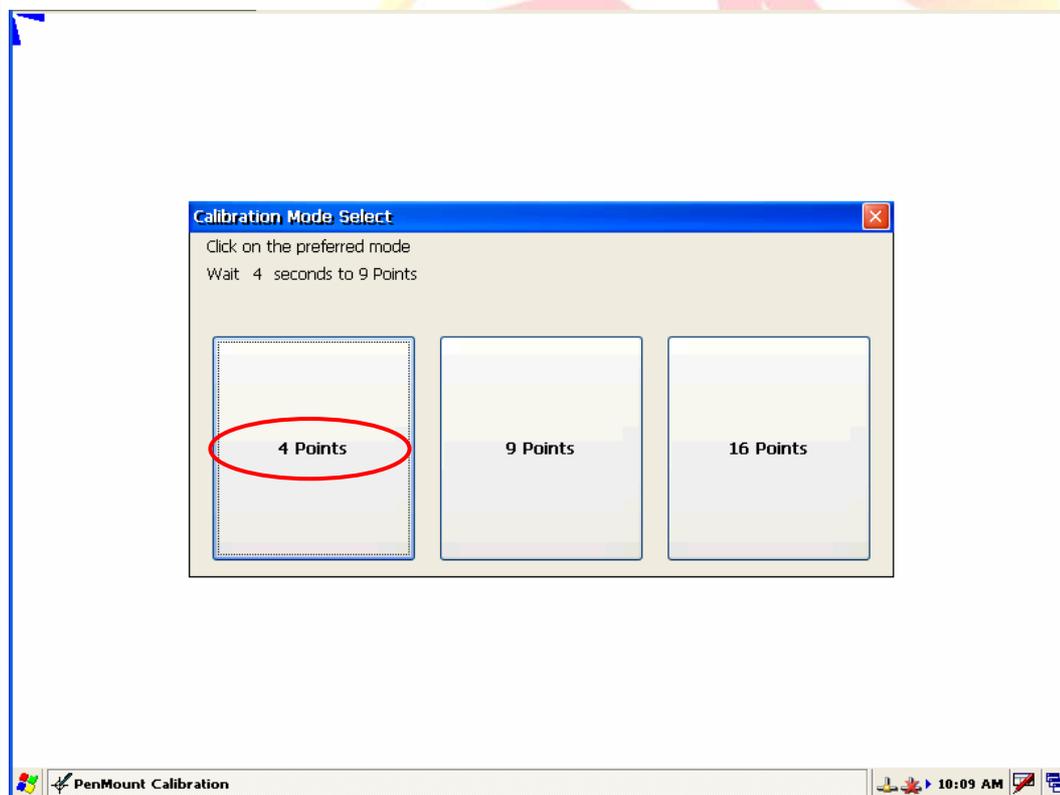

USB Hub

To calibrate a PenMount USB touch panel, perform the following steps:

Step 1: Execute the calibration program.

1.1. After rebooting, click the Start->USB_TOUCH->PenMount-> Calibration.

1.2. Click the "4 Points" button. (Click the "9 Points" or "16 Points" button to obtain a more accurate calibration for the touch panel)

1.3. Perform the calibration process.

1.3.1. Touch the "✛" icons on the monitor to perform the calibration process.